SURVEY OF HAZARDOUS/CHEMICAL AREA NO. 2 OF THE FORMER ST. LOUIS ORDNANCE PLANT

VOLUME LI

William R. Colvin Joseph H. Zarzycki

June 1981

FINAL REPORT



Distribution limited to US Government Agencies:
Evaluation of Another Command: June 1981
Requests for this document must be referred to:
Commander, USATHAMA, ATTN: DRXTH-ES, APG-EA, MD 21010

US Army Toxic and Hazardous Materials Agency Aberdeen Proving Ground, MD 21010 Site: \$\frac{\S}{2} \tau_{\text{outs 0}, \lambda_{\text{outs 0}}}{10 \text{ * Mo82/00224/65 0}}

Break: \$\frac{1}{2} \text{b}\$

Other:

DISCLARGE

The views, opinions and/or findings contained in this report are those of the authors and should not be constructed as an official Department of the Army position, policy, or facision, unless so designated by other focuments.

REPORT DOCUMENTATION	READ INSTRUCTIONS BEFORE COMPLETING FORM				
T. REPORT NUMBER	2. GOVT ACCESSION NO.	S. RECIPIENT'S CATALOG NUMBER			
Report DRXTH-FS-TR-81105					
4 TITLE (and Bubmile)	-	S TYPE OF REPORT & PERIOD COVERED			
Survey of Hazardous/Chemical Area of the Former St. Louis Ordnance		Final Report			
VOLUME I	FISHC	6. PERFORMING ORG. REPORT NUMBER			
7 Au TyiOR(s)		S. CONTRACT OR GRANT NUMBER(*)			
william R. Colvin					
Joseph H. Zarzyck.					
P PERFORMING ORGANIZATION NAME AND ADDRESS		16 PROGRAM ELEMENT, PROJECT, TASK AREA & BORK UNIT NUMBERS			
US Army Toxic and Hazardous Mater Abordeen Proving Ground, MD 2101					
produces Froving Ground, 40 2101		••			
TE CONTROLLING OFFICE MAME AND ADDRESS		12 REPORT DATE			
US Army Texts and dezardous Mater	tals Acency	June 1981			
Aberdeen Proving Ground, MD 2101		18 NUMBER OF PAGES			
TE MONITORING AGENCY HAME & ADDRESSIS distorm		18 SECURITY CLASS (at this report)			
		Unclassified			
	:				
		SCHEDULE			
In transition, implied to the deversal value of the four ther communicated of the decimal mast be a superior of the community of the superior	e referred to: -Eo, APU-EA, MD				
TO SEE BUT THE STATEMENT OF THE STATEMEN	in miljet 30, it dillelijni me	m Порым;			
8 S PP. FMPHTARY N: TES					
e de la companya de					
g att a Minn with a minner or or of the incoming de-	a identity by his & sumber-				
		1			
en e		\			
A ST A BOTTON A	tons for his to the company	1			
•	•				
•					
	, ,				
and the second s	and the second s				

The second secon

LATION OF THIS PARKETON Dote Between

Therefore, the USATHAMA survey of Hazardous/Chemical Area No. 2 was conducted in two phases: Phase I was the survey of the GUSARC and Phase II was the survey of the Hanley Area.

The findings of the GUSARC Area survey (conducted January - May 1979) revealed the presence of heavy metal residues on the interior surfaces of buildings as well as the presence of explosive residues in the floor drains of four buildings. This information was transmitted to DOL in June 1979 to provide guidance for their renovation and demolition activities in the GUSARC Area.

The findings of the Hanley Area survey (conducted August-Rovember 1980) showed heavy metal residues to be present on the interior surfaces of all buildings and in the aqueous discharge of the sewer system. Additionally, explosive residues were found on the interiors of several buildings and magazines and in the water of several powder wells draining two buildings. It is recommended that four buildings, eight magazines and all powder wells be decontaminated to remove the potential explosive hazard.

EXECUTIVE SUMMARY

The Hazardous/Chamical Area No. 2 of the former St. Louis Ordnance Plant (SLOP) was surveyed for amplosive and heavy metal contamination. A portion of this area was occupied as the Goodfellow US Army Reserve Center (GUSANC) from 1960-1977 and used for Army Reserve operations and training; the remaining portion was utilized by Hanlay Industries, Inc. from 1959-1979 for the manufacturing of explosive and pyrotechnic devices. The Department of Labor (DOL) desires both the GUSARC and the Hanley Areas for the site of a Job Corps Center. The DOL had need for the earliest possible use of the GUSARC Area. Therefore, the USANTAMA survey of Hazardous/Chemical Area No. 2 was conducted in two phases: Phase I was the survey of the GUSARC and Phase II was the survey of the Hanley Area.

The findings of the GUSARC Area survey (conducted January-May 1979) revealed the presence of heavy metal residues on the interior surfaces of buildings as well as the presence of explosive residues in the floor drains of four buildings. This information was transmitted to DOL in June 1979 to provide guidance for their removation and demolition activities in the GUSARC Area.

The findings of the Hanley Area survey (conducted August-Hovember 1980) showed heavy metal residues to be present on the interior surfaces of all buildings and in the aqueous discharge of the sever system. Additionally, explosive residues were found on the interiors of several buildings and magazines and in the water of several powder wells draining two buildings. It is recommended that four buildings, eight magazines and all powder wells be decontaminated to remove the potential explosive hazard.

VOLUME I

TABLE OF CONTENTS

· ·	
EXECUTIVE SURMARY	
TABLE OF CONTENTS	A STATE OF THE STA
List of Floures	iv.
LIST OF TABLES	
I. INTRODUCTION	
II. AFTWORITY	
III. BACKGROUND	
A . O	
A. General	
B Milakana	
B. History	
1 0100 Avenall Disch Overstens	The second second second second
1. SLOP Overall Plant Operations	
2. Marardous/Chemical Area No. 2	
2. Hazardous/Chemical Area Mo. 2	- 1941-1943
3. Hasardous/Chemical Area No. 2	
J. MASSTONES/CHEMICS: ATES NO. &	
4. Hezerdous/Chemical Area No. 2	- 1050-1070
4. messinger/dicarrar wide my, 1	
IV. SURVEY OFERVIEW	12
FAT COMART CARMATON	
A. Historical Study	12
n	
B. Survey Effort	13
C. Evaluation of Data	17
,	
1. Explosives Contemination	
2. Heavy Metals	And the second s
	The state of the s
D. Date Management	18
<u>-</u>	
E. Actions Interim to Study Completion	xa
•	
1. Statement for Use of GURANC	
2. DOL Access to Hanley Area Price	n to Survey Conclusion 😘
3. Interim Status Report on the H	ianley Area

NOT THE I

TABLE OF CONTENTS (Cont'd)

V. Setoretier IS ARRY RE	EZPUT COMMON COMMON		•	San Table
& Constal	SERVE CENTER SURVEY	SAMPLING AND	ARALYSIS	21
			. 14	21
A. Burry Metals	•			
C. Diplosives				:68
L. Book Sprays				24
2. Thin Leyer Chr.			•	
3. Bigh Performant	ce Liquid Chromatao	graphy		
9. Survey Besults				\$v
A. Weavy Netal Con				83
2. Explicate Conta	mination		- :	
WE. MASKET AREA SURVEY SAM				
A. General				23
S. Many Motels				23
i. Swipe Samples			.	23
2. Physical Samples	3		•	
C. Explosives			٠.	
1. Spot Sprays		•	•	26
2. Svabe				
3. Physical Samples			. * **	
D. Survey Results				
1. Heavy Metal Conta	minetion			26
2. Explosive Contami	Dobina			* •

AGT THE I

TABLE OF CONTENTS (Cont'd)

			Page
VII. ,	-CONCLUSIONS	•	30
A.	. Goodfellow U	S Army Reserve Center	30
	1. Heavy Me	tal Residues	•
	2. Explosive	e Residues	
B	. The Hanley A	rea *	30
	1. Heavy Me	tal Residues	
	2. Explosiv	e Residues	
VIII.	RECOMMENDATION	NS .	35
A	. Goodfellow U	S Army Reserve Center	35
B	. Hanley Area		35
IX.	REFERENCES		37
	APPENDICES - VO	LUNE II	
	Appendix A:	Authority	
•	Appendix B:	Archives Search	
	Appendix C:	Description of Building: in the Goodfellow US Army Reserve Center and Hanley Areas	
	Appendix D:	Tables of Complete Analytical Results .	
	Appendix E:	Analytical Methods and Quality Assurance Data for the Goodfellow US Army Reserve Center Survey	
	Appendix F:	Analytical Methods and Quality Assurance Data for the Hanley Area Survey	
	Appendix G:	Sample Standard Operating Procedure. "Demolition Plan for the 400 Area (Explosives Manufacturing Area of Frankford Arsenal"	1)

LIST OF FIGURES

	•	
Figure 1.	St. Louis Ordnance Plant and Vicinity Depicting Hazardous/Chemical Area Ro. 2	. 2
Figure 2.	Outlease Map of St. Louis Ordnance Plant	4
Figure 3.	Renley and GUSARC Areas of Former Reservous/ Chamical Area-Ho. 2 of SLOP	.
Figure 4.	Building/Hagazine Humbers - Hazardous/Chamical Area Hp. 2 of SLOP	7
Figure 5.	Location of Access Bridge To and Ges Line Bight-of-Way Through the Hanley Area	20
Figure 6.	GUSARC Facilities Contaminated with Heavy Matal Residues	24
Figure 7.	GUSARC Magazines in Which Floor Drains Were Found to Contain Explosive Residues	25
Figure 8.	Renley Area Pacilities Contaminated with Heavy Metal Residues	28
Pigure 9.	Ranley Area Facilities Contaminated with Explosive Residues	. 29

LIST OF TABLES

			Pege
table	1.	Ranley Industries Explosive Trains and Components Designed	8
Pable	2.	Hanley Industries Explosive Components Loaded for the Hilitary and HASA	9
Table	3.	Henley Industries Buildings/Megacines in which Loading and Mixing of Explosives were Conducted	9
Table	4.	Hanley Industries Buildings Usage Other than for Loading and Mixing of Explosives	10
Table	5.	Hanley Industries Compounds Utilised	11
Table	6.	Potential Contaminants in the GUBARC Area, SLOP	14
Table	7.	Potential Contaminants in the Hanley Area, SLOP	15
Table	8.	Areas of Potential Contamination, Ranley Area, SLOP	16
Table	۹.	Summary of GUSARC Sampling Program	22
Table	10.	GUSARC Survey Findings	31
Table	11.	Renley Area Survey Findings	32

•

L. INTEUDICUTION.

Rezerdous/Chemical Area No. 2 (27.88 acres) of the former St. Louis Ordnance Plant (LLT) is desired by Department of Labor (DOL) for use as 2 Job Corps Training Center. This property is considered excess to Army needs. The US Army Toxic and Bazardous Materials Agency (USATRAMA) was requested to study the property with respect to ascertaining the "status of contamination" and to determine the suitability of the property for release.

The USATRANA program was conducted in two phases due to DOL schedule considerations and the requirements of an Army lease with Hanley Industries. Each phase consisted of three eteps: historical review of property usage, survey consisting of sampling and chemical analysis, and data evaluation. Buring the period January through May 1979, a 13.2 acre portion of the property, referred to as the Goodfellow US Army Reserve Center (GUSARC) Area, was surveyed. The remaining 14.68 acres, referred to as the Hanley Area, were surveyed during the period August-November 1980.

The following sections of this document describe the results obtained and information gathered by USATHAMA during its study of the Hazardous/Chemical Area No. 2. Section II and Appendix A provide the authority for the program. Section III presents an overview of the technical program conducted by USATHAMA. Section IV provides background information, primarily of a historical nature. The historical information in this section is extracted from an archives search which USATHAMA conducted; the complete archives search is at appendix B. Sections V and VI are descriptions of the sampling and analysis efforts conducted at the GUSARC and Hanley Areas, respectively. All analytical results as well as laboratory quality control data and method descriptions for the analytical program are contained in appendices D, E, and F. Conclusions and recommendations are found in sections VII and VIII, respectively. This report has been prepared in two volumes; volume II contains appendices A through F.

- II. AUTHORITY. Authority for conducting this survey of the SLOP is contained in:
- A. 1st Indorsement, DRCIS-EP, DARCON, to RQDA letter (December 18, 1980) dated January 17, 1979, subject: Installation Restoration, Goodfellow US Army Reserve Center (Portion of Former St. Louis Ordnance Plant), Missouri. (Document contained at appendix A).
- B. DARCON Regulation 10-30, May 22, 1979 which establishes the US Army Toxic and Hazardous Materials Agency and its mission.
- C. Federal Register Vol. 45, No. 209, Oct 27, 1980 Amendments to Real Setate Handbook, Subpart F Disposal.

III. BACKGROUND.

. \$

A. General. SLOP is located within the city limits of St. Louis, Missouri (Fig 1). The eros surrounding SLOP is commercial, residential and industrial. The USATHAMA program addresses only the 27.88 acres comprising Hazardous/Chemical Area No. 2 of the former ordnance plant.



7

Figure 1. St. Louis Ordance Plant and vicinity depicting Hazardous/Chemical Area No. 2.

B. Ristory.

1. St. Louis Ordnance Plant Overall Plant Operations

a. 1941-1959

(1) General: Construction was started during January 1941 and was completed in Nay 1942. Initial production, however, started as early as December 1941. During World War II, the 300-acre facility was operated as a Government-owned, contractor-operated (GOCO) plant for the production of small arms ammunition (caliber .30 and .50) and components for the 105mm shells.

(2) Major Contractor Operatore:

- (a) The United States Cartridge Company (U. S. Cartridge), a subsidiary of Olin Industries, operated the ammunition plant for manufacture of small arms ammunition and produced 67 million rounds. U. S. Cartridge occupied plants No. 1 and 2 (Fig 2). Plant No. 1 comprised buildings in the 100 series and plant No. 2, buildings in the 200 series.
- (b) The McQuay-Norris Manufacturing Company operated the plant for manufacture of cores for small arms ammunition and produced eight billion cores. McQuay-Norris occupied the 113 building series on the extreme south end, located south of highway 70 on Goodfellow Blvd. near Natural Bridge Road.
- (c) The Chevrolet-Shell Division of the General Motors Corporation operated the shell plant for the manufacture of 102mm shells. The facility began production late in 1945 following the change over from small arms amountion manufacturing. The number of shells produced is unknown.

Following deactivation of the plant in 1945, all property and buildings except the McQuay-Norris plant were transferred to the Seventh Service Command for use as an administrative center for the Army Service Porces.

b. 1945-1959. From 1945 to 1951 the plant was utilized as a center for maintaining and servicing records of the U.S. Army Adjutant General's Office and the Finance Center. During this period the plant was administered by the St. Louis Administration Center under the jurisdiction of the Fifth Army Region. On May 1, 1952 the St. Louis Administration Center was discontinued and its function transferred to SLOP. These functions consisted of Army housekeeping services to Army Finance Center. Effective 1 December 1957 the SLOP was placed in an inactive status.

2. Hezardovs/Chemical Area No. 2, 1941-1945

a. General. According to information provided by a former employee, magnesium was used in buildings 223A and B for tracer bullet manufacture. In building 234, on the extreme south end, lead styphnate and possibly tetragene were used in the manufacture of primers and several buildings were used for explosive mixing and storage.

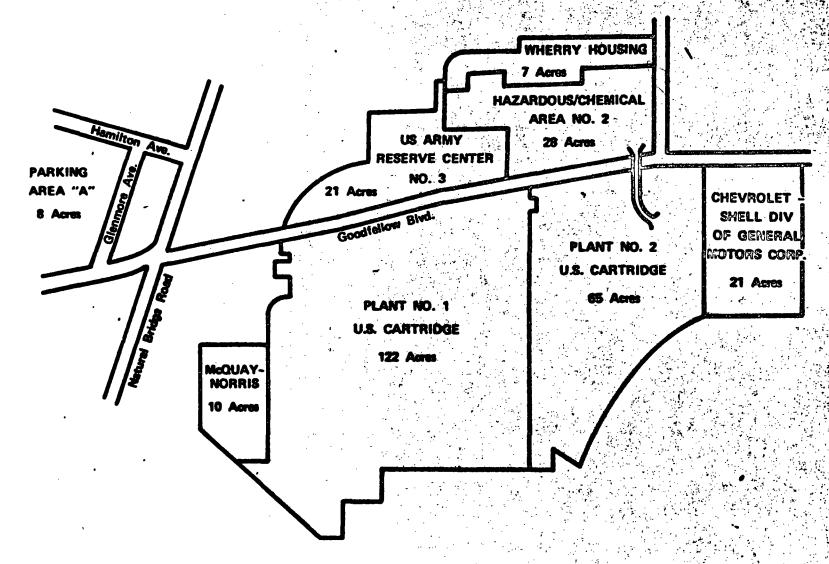


Figure 2. Outlesso map of St. Louis Ordence Plant.

- b. Decontamination. In 1945, following deactivation of SLOP, buildings having explosive contamination were decoateminated by the Army COR reportedly in accordance with regulations of the Safety and Security Branch, Office, Chief of Ordnance, Chicago. However, no records are available which describe the procedures employed or the results obtained in the decontamination project. All special equipment peculiar to the production of small arms ammunition was declared excess and recommended for acrapping. All multi-purpose equipment was made available to the Reconstruction Finance Corporation for disposition.
- 3. Hexerdous/Chemical Area Ro. 2, 1945-1959. As buildings were made evailable, the US Army Finance Center used them for classrooms until 1951. At that time the area was rehabilitated for small arms ammunition manufacture. The machinery was installed but production never commenced. After the Korean Conflict, the machinery was removed and disposed of.

4. Bezardous/Chemical Area No. 2, 1959-1979.

e. General. Hanley Industries, Inc. (a subsidiary of RDI Precision Products) leased 14.68 acres of Hazardous/Chemical Area No. 2 of SLOP from September 1, 1959 to August 31, 1979. In the early 1960's, the Coodfellow US Army Reserve Center (GUSARC) was established on the remaining 13 acres of Hazardous/Chemical Area No. 2 (Fig. 3). Shown on Figure 4 are the building/magazine/bunker numbers for the structures in both the GUSARC and Hanley Areas.

b. Ranley Industries, Inc. (Hanley) Operations.

(1) Manufacturing Operations

Hanley operated equipment normally required for the synthesis receiving, drying, ecreening, mixing, loading, pressing and testing of explosives. Hanley did considerable work in the design of explosive trains and components (Table 1). Additionally explosive components were loaded for the military, and the National Aeronautical and Space Administration (NASA) (Table 2).

Most of Hanley's buildings were used for loading detonators and primars and for explosive mixing (Table 3). Explosives were dried in magazines 219C, B, F, J and H by leaving cans of explosives (without lids) exposed to the air.

Hanley operated a lead axide reactor in magazine 2198. Feed tanks were located just outside the concrete wall. Two feed lines for the conveyance of sodium axide and lead nitrate ran via overhead supports from the tanks to the reactor (two pumps were used). The tanks, feed lines and reactor have been removed. Table 4 lists the buildings usage during Manley's lease.

A list of compounds which Manley used is shown on Table 5.

(2) Disposal Operations.

Hanley used none of the existing sumps or powder wells located on the property. Paper and cloths contaminated with explosives were burned in the basement of 218C. Open burning of explosives was also conducted in magazines 219r and J. All other explosives wastes were transported to Fort Leonard Wood for disposal.

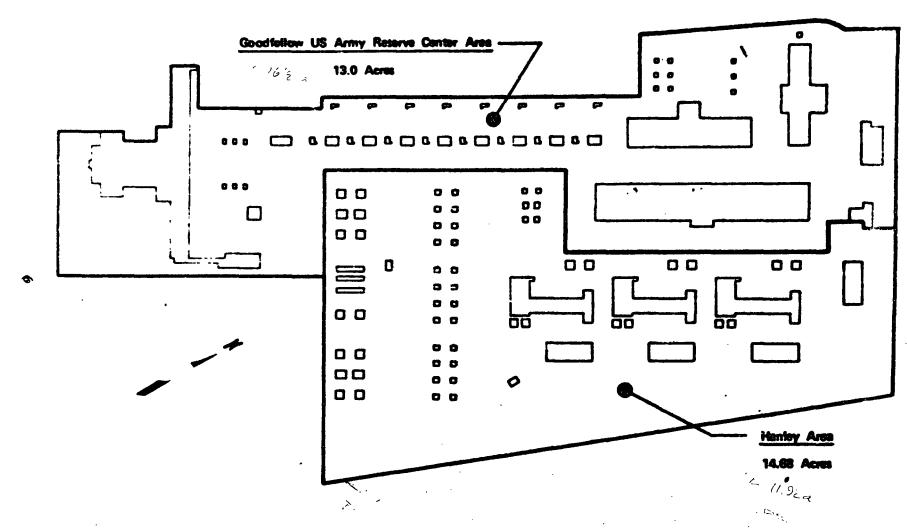


Figure 3. Hanley and Goodfellow US Army Reserve Center Areas of Former Hazardous/chemical Area No. 2 of SLOP.

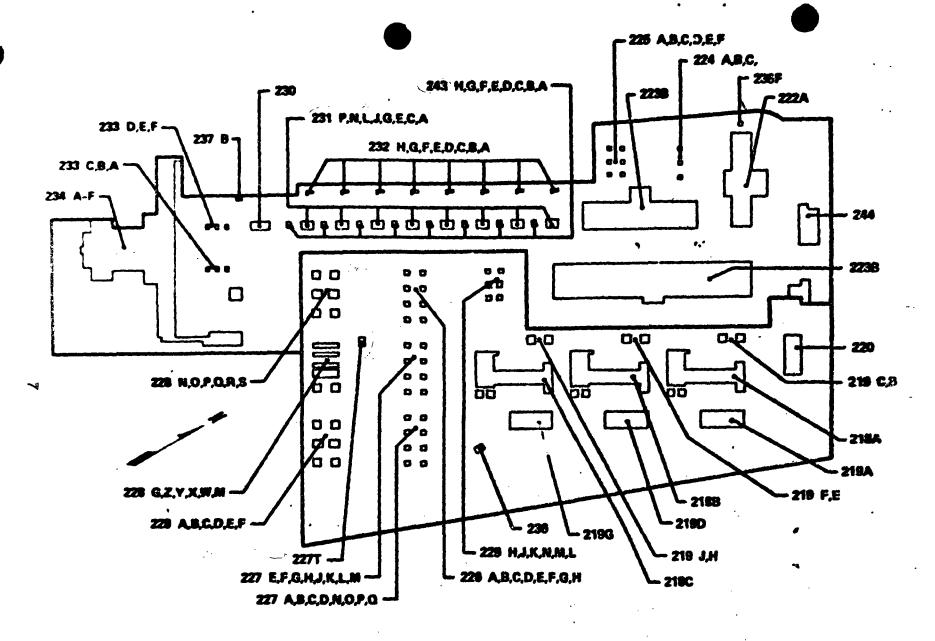


Figure 4. Building/Mugazine Numbers - Hazardous/Chemical Area No. 2 of SLOP.

Healey Industries

Explosive Trains and Compenents Designed

Explisive bolte

Cord cutters

Bolt cutters

Battery activiation cartridges

Cartridges to spin up a gyroscope

Balloon inflators

Bellow and piston motors

Pallets of explosives

Bailer tube expansion charges

Unusual primary explosives

Spotting charges for warheads

Explosive detents

Indicators

Smoke and flash eignals

Explosive or equib switches

Certridges to uncage a gyroscope

Boosters

Pyrotechnic delay cartridges and detonators to open lap belts

Deploy perachutes

High altitude sounding granades

Banley Industries

Explosive Components Loaded for the Military and MASA

Delay cartridges
Leads
Detonators
Primers (electric and delay)
Squibs
Explosive Bolts
Activators
Bomb Initiators
Spotting charges
Boosters

TABLE 3

Manley Industries

Buildings/Magazines in Which Loading and Mixing of

Explosives were Conducted

Bldg	Room
220	All rooms except basement
218A	102, 104, 105, 106, 107, 108, 109, 110, 111, 112, 113, 117, 121, 123. Delay powder loaded in besement under Room 105.
2183	1:0, 113, 115, 119, 123, 125, 127, 128-1, 128-2, 128-3, 128-4, 132
218C	104
219A	Loading of smokeless powder throughout

Henley Industries

Building Usage

Other than for Loading and Mixing of Explosives

<u>8169</u>	Area .	Usage
218A ·	All rooms not listed on Table 3	Non-explosive storage
2168	Sesement	Empty as non-explosive storage
518C	Basement	Burning of explosive contaminated rags
2190		Never used
2196		One time loading of explosives for disposal during cleanup operations
219C, 8, F, J & H	•	Drying of explosives
21 9 E		Lead azide production
All • other maga- zines		Storage of explosives in sealed containers
219A	·	Administrative

*Fencing arrangements in the 228 area reportedly precluded both beneficial and non-peneficial use of magazines 228A, B, C, D, G, N, O, and P by Hanley Industries. The Goodfellow US Army Reserve Center reportedly used these facilities intermittently for storage of equipment.

Hanley Industries

Compounds Utilised

Leed Styphoste

Tetryl (2,4,6-Trinitrophenylmethylmitromiam)

EDI

WOL 130 (Ignition mix)

A180 (Ignition mix)

Black Powder

HME (Cyclotetramethylenetetramitramine)

WOL 60 (Ignition mis)

PETM (Penteerythrite Tetranitrate)

Tetracene

Silver azide

Smokeless powder

Trinitroresorcinol

Diesodinitrophenol

Delay powder

Lead nitrate

Sodium aside

IV. SURVEY OVERVIEW.

A. Bistorical Study.

Because Hazardous/Chemical Area No. 2 was a portion of the forcer SLOP, it was necessary to determine if the property is contaminated with explosives or other hazardous materials prior to proceeding with actions to dispose of the property. As a first step in the program an historical investigation was conducted.

All available records were searched in an attempt to define the past operations which took place within the 27.88-acre area. This effort included searching the following document repositories: National Personnel Records Center, St. Louis, MD; Industrial Social Division of the National Archives, Washington, DC; Washington National Records Center, Suitland, MD; Offices of the Reneas City District Corps of Engineers, Kansas City, MD; and the Historical Office of the Army Armament Readiness Command, Rock Island, IL.

In a further attempt to gain information on the operations which took place at the site, old overhead imagery was obtained and studied. This information was obtained from EPA's Vint Hill Farms Station at Vint Hill Farms, Virginia.

Although a large amount of information was found, documents specific to building and magazine usage and decontamination were not located. Several documents which would have been useful had been destroyed (Appendix B, paragraph IV. B). Information on building usage and past decontamination efforts would have been extremely useful for: (a) tailoring the sampling and analysis efforts; (b) drawing conclusions about the status of residual contamination within the area with relatively little sampling and analysis data; and (c) allowing historical data and chemical analysis data to function as cross checks of each other.

Another means utilized to obtain information about past operations was personnel interviews with current and former employees. This technique produced some relevant information, however, the information could not be corroborated by other sources.

Over a 20 year period beginning in 1959, Hanley Industries, Inc., leased a 14.68 acre portion of Hazardous/Chemical area No. 2. During this period Hazardou manufactured explosive devices. Hanley personnel were contacted to ascertain the building usage during their lease.

Results from this first step of the program produced some information on which buildings would likely be contaminated and with what materials. Although the archives search revealed that renovation and decontamination operations were conducted in the Hazardous/Chemical Area No. 2, there were no available documents which described the operations, or the level to which decontamination was actually achieved.

B. Survey Effort.

Historical information about Hazardous/Chemical Area No. 2 led to the development of a table of potential contaminants for which analyses would be conducted. The contaminants for the GUSARC area are shown as Table 6. The number of contaminants of concern was expanded for the Hanley Area survey to take, into account operations occurring between 1959 and 1979 (Table 7).

Information provided by Ranley personnel led to the following conclusions:

- 1. Samples would have to be collected and analyzed for the potential contaminents listed on Table 7.
- 2. The areas of potential contamination tabulated on Table 8 would have to be sampled.
- 1. Heavy metal contamination was considered to be unlikely in most of the megasines in the Hanley Area as only a few of the megasines were used by Hanley and then only for the storage of explosive and supply items.
- 4. Hanley had never used the powder wells. The powder wells, unlike the other structures, did not have a 5% marking on them. Therefore, the powder wells in the Hanley Area were considered to have a high potential for containing explosive residues.

In order to select the locations for sampling, interior building configuration data were compared with the available historical information. Provided as Appendix C is a description of the various buildings and magazines which comprise Hazardous/Chemical Area No. 2.

Sampling and enalysis for the GUSARC Area was performed under contract by Sattelle Columbus Laboratories. The sampling effort was conducted in April 1979, and laboratory enalysis in May 1979. Shortly thereafter the DOL representatives began renovating portions of the property.

Sampling and analysis of the Hanley Area was initiated August 1980. This was shortly after decontamination procedures were accomplished by Hanley personnel in compliance with lease termination requirements. Chemical analyses were performed in September and October 1980 with preliminary results of most analyses available in Hovember 1980. The sampling and chemical analysis survey of the Hanley Area was also conducted under contract by Battelle Columbus Laboratories.

The survey program conducted at Hazardous/Chemical Area No. 2 utilised state-of-the-art detection methodology for explosives. This program included a cost effective mix of indicator sprays, thin layer chromatography (TLC) analyses and analyses of select samples by High Performance Liquid Chromatography. Sampling efforts focused on the areas most libe to contain contamination. The sampling and analysis efforts were designed to provide data which would form the

Potential Conteminants in the GUBARC Area, SLOP

2,4,6-Trinitroresorcinol (etyphnic acid (TMR))

Cyclotrimethylenetrinitemine (EDX)

2,4,6-Trinitrotoluene (TMT)

Witroglycerine (WG)

Penteerythrite Tetranitrate (PSTM)

Witrocellulose (NC)

Lead Styphnete (PbSty)

Tetrasene (TETR)

Cedmiuin (Cd)

Chronium (Cr)

Lead (Pb)

Mercury (Rg)

Potential Contaminants in the Hanley Area, SLOP

2,4,6-Trinitrotoluene (TMT)

2,4- and 2,6-Dinitrotoluene (DMT)

2,4,6-Trinitrophenylmethylnitromine (Tetryl)

2,4,6-Trinitreresorcinol (Styphnic Acid)

Cyclotetramethylenetecranitramine (HKX)

Penteerythrite Tetrenitrate (FETM)

Lead Styphnate (Load Salt of Styphnic Acid)

Tetrasene (TETR)

Mitroglycerine (MG)

Mitrocellulese (NC)

Lead (Pb)

Silver (Ag)

Rickel (Ri)

Mercury (Rg)

Chronium (Cr)

Cedaica (Cd)

Areas of Fountial Explosive Contemination .

Banley Area, SLOP

	Building/Ragasine	. Area
	220	All rooms
	218	15 rooms
	2188	12 rooms
-	218C	1 room and basement
POTESTIAL.	2194	All rooms
5	219C, R, J, H	Throughout
E CE	219G	Throughout
-	2278, L, P, Q	Throughout
	226C, G	Throughout
	229H	Throughout
	Powder wells	Throughout
	Sower lines	Throughout
23	2270, N, N, E, J, H, G, F, E, D, C, A	Throughout
NODERATE POTENTIAL	226H, F, E, D, B, A	Throughout
ğ E	229L, W, H, J, K	Throughout
	2271	
ا در	228 Series	
LOW POTESTIAL	Boil .	
25	Soils	
	Pipe Tunnels	
	Crawl Spaces	

basis for a conclusion about the presence of contaminants which would pose an explosives safety hazard. Indicator sprays were applied and swab samples were collected for TLC analysis where positive results were obtained from the indicator sprays. Swipe samples were used to check for the presence of, heavy metal contamination on building interior surfaces. These samples were then taken to the laboratory for analyses by atomic Absorption Spectrometry.

The sampling of the Goodfellow US Army Reserve Center (13.2 acres) included sampling the interior surfaces of 41 buildings and seven bunkers for heavy metals and explosives. Spot sprays to detect the presence of explosives were extensively applied on and around floor drains and in cracks on floors and ceilings.

The sampling of the Hanley Area (14.6) acres) included the survey of seven buildings, 54 magazines and 28 powder wells. All buildings and magazines were checked for heavy metals and explosives on interior wall surfaces, in and around floor drains, and in cracks and drop ceilings. Powder wells and sever lines were sampled and subjected to analyses for explosives and heavy metals.

In addition to sampling and analysis the survey included a visual inspection of the grounds, buildings and underground tunnels. During the visual inspection dutunators were found behind magnetic 2198 (these were produced by Hanley, Inc.) in spite of the fact that Hanley personnel had already cleaned up the area. (These detonators were removed by Hanley personnel in August 1980.) Inspection of the buildings in the Hanley Area indicated that in several cases interior building walls were constructed of hollow tile in which explosives may have accumulated.

C. Evaluation of Data.

1. Explosives Contamination.

Results of the historical study and the sampling and analysis effort were used to infer the likelihood of an explosives contamination problem. Based on the historical survey of the GUSARC area it was believed that only a few buildings would have possibly been contaminated. Analytical data revealed that building interior surfaces were not contaminated.

In the Hanley Area, on the other hand, contamination was detected in several of the buildings and some of the magazines. The likelihood of contamination in this area was much higher because of operations conducted during World War II and subsequently by Hanley Industries. This area also contained powder wells which served as drainage sumps for the buildings. Certain powder wells showed trace levels of explosives in the standing water.

A third factor in the evaluation process was the configuration of structures themselves. Areas where explosives could accumulate in quantities posing a safety hazard are a concern. Building configurations were studied to determine if there were such areas. Places of likely accumulation were sampled. However, areas such as hollow tiles and drop teilings could not be readily and safely sampled.

2. Heavy Metals.

Swipe samples were taken to obtain estimates of heavy metals levels on surfaces within a given building. The results of sampling and analysis surveys of the GUSARC and the Hanley Area showed that heavy metals (lead, mercury, silver, nickel, cadmium, chromium) were present on the building interior surfaces.

Based on levels measured on building interior walls inferences can be made as to the ingestion hazard. On this basis several of the buildings are not suitable for release due to lead contamination. With respect to occupational usage of the buildings, as is planned by DDL, the determination of a hazard depends on the future specific use of the buildings because the potential hazard is a function of the building use and the amount of material which will become airborne as a result of that use. Air monitoring during renovation and occupancy would be necessary to assure compliance with DSHA limits. Air monitoring of vacant structures as part of the survey program was judged not to be of sufficient value over swipe sampling to warrant the additional expenditure of funds.

D. Data Management.

Data collected in the field, i.e., sampling location, type of indicator spray applied, were logged on field data sheets. This information was transferred onto USATHAMA sampling and analysis forms, merged with laboratory analysis result data, validated by the contractor and submitted to USATHAMA. This data was reviewed and validated by USATHAMA and entered into the USATHAMA Data Management System where it was keyed to a computerized map of the Hanley Area.

E. Actions Interim to Study Completion.

1. Statement for Use of GUSARC.

The DOL requested that the GUSARC Area be made available as soon as possible and that separate certifications be provided for each area; the GUSARC area first, with the Hanley area certification provided shortly thereafter.

To Compare the Com

- e. Conduct oir adultability for Loovy waters to essure compliance with COM ethnology.
- b. Earlie the liquid diretaryo from the cause eyetch to essure compliance with the distinguistic currents of the city of St. Louis.
 - 2. I'l farmer to Tailer four Pries to Survey Correlation.

In craite masting was talk in June 1980 with representatives of DOL, the Ransas Caiy lictrict Congrad Lancors Real Latete Division, the Post Engineer for the Ct. Louis Ares Arry Frankou, Lankey Industries and USATIVAL attending. This pretian was half to (a) on last a visual impaction of the Harley Iras prior to the final Pretial of the escape of work for the USANAAM survey of the story (b) story a for the escape to the Usalay Ares via the bridge over Goodfellow Louiseverd (Fig. 5); and (c) determine the acceptability of the gas line route which was proposed by the DOL.

During June 1930, USATRAMA responded favorebly to DSL's request to route gas line as shewn on Fig. 5 and concurred in DSL's use of the access bridge over Goodfellow Bowleverd provided that a security fance was installed so as to totally fence off the potentially contaminated area bordering the road between the access bridge and the former GUSALS Area.

- 3. Interim Status Fenert on the Barley Area. At the request of DOL, USATEAMA project an interim status report for the hanley Area based on the preliminary results obtained from the survey conducted August-October 1980. The status report, submitted to the US Army Material Development and Readiness Command Meadquarters indicated the following:
- a. Explosive residues were present in a few powder wells and in some buildings (on walls, floors, window sills).
- b. Heavy notal residues are present in sever lines and on all building interior surfaces.

Figure 5. Location of access bridge to and gasoline right-of-way through the Handley Area.

20

V. COODFELLOW US ARMY RESERVE CENTER SURVEY SAMPLIES AND ANALYSIS.

- A. <u>General</u>. Him multiple-chamber powder sumps, seven bunkers and 41 buildings were sampled for heavy metal and explosive residues. The compounds of interest are listed on Table 6. Summarized on Table 9 is the GUSARC sampling program for the collection of samples to be analyzed for explosives and heavy metals.
- B. Beavy metals. The sampling for heavy metals was accomplished by wiping one square meter of surface area with a ten-inch diameter Whatman No. 541 filter paper which was wet with a 5-6 ml water/detergent solution prior to sampling and placed in a sip-lock plastic bag. These swipe samples were analyzed for concentrations of lead, chromium and cadmium by inductively coupled plasma spectroscopy (Appendix E, Mathods Descriptions). Mercury analyses were conducted using an atomic absorption spectrophotometer method.

C. Explosives.

1. Boot Sprays. Preliminary evaluation of the presence of selected explosives was conducted by spraying building surfaces with reagents which give positive color responses in the presence of certain explosive compounds. Four different aprays were used to detect four different explosive classes. Each spray was applied to different locations within a one-meter square area (with a suitable interval between sprays to prevent mixing of spray materials on the building surface). One hundred and seventy-seven spot sprays were applied in the buildings and bunkers.

2. Thin Layer Chronatography.

Five samples were collected with a cotton swab in buildings where positive reactions to the spot sprays resulted. Physical samples (sludge and dust) were also collected and composited by building for analysis using thin layer chromatography (TLC).

3. Bigh Performance Liquid Chromatography.

Water samples from powder sumps were examined using high performance liquid chromatography (HPLC). HPLC analyses were also conducted to confirm the presence of PETH and HC found as a result of conducting the TLC analyses.

Summary of GUSARC
Sampling Program

٠.	.]	ba A I	ldle		د دور کړي د د د د د	Svi		. 4.	.		-	•	_				2 1		: ``		, 1 <u>.</u>		·	٠
	1	134				-21			-	916	. •	4.	les		<u>B</u>	ray	•		<u> </u>	aba		Bu	⊞рø	
	6	يہر	(a)				· · · · · · ·				11)				30				3	r F a		, 3	
	. : .										19			*		43			. 1) }		•	3	
•			(8)	المارة المارة		11		•			13					16	• 1.			i Park			3	, e.,
			(A)								8			<i>i. i.</i>		11	3.4	ا مر			. :			
ì.	. 2	44	v 10.		331				3.		1			•		6				4.				٠,
•		31	(ser	lw)		•					21	-				24	ا سات							
: \ -	3	13	(eer	les)		9				· · ·	24		*								1		,lk	٠.
	2	3 2 (loor	loo)		9							2,		. : ,	24								
			'Sro		75											16						4.	: :*	
		bui	ker								•					7	and the				1 - 1	•	34 34	
:	21												. 25 ¹ 1. 1 114		÷	•			Α.,					
.:	100	TAL	(38	9)		_		· · · ·		-	-				-	_	. :	• •		. š 5	 /* ,		•	
		:		••		90			٠.	. 1	07				17	7			5	·		10		

Surpey Posults

eavy Metal Contamination

Meavy metal residues were found in the walls of the following s/bunkers (Fig. 6);

2312		or con solitoning
231P	. 2327	
232A	2326	2430
2328 2320	232E	2438
232D	234	2437.
232E	2434	243c
,	243a 243c	24 JH
EGRCONA	4436	. 244

Heavy metal concentrations were reported in units of micrograms r (ug/m2) and concentrations ranged as follows:

0.99 ug/m² - 4422 ug/m² mim:

2.20 g/m² - 5562 ug/m²

1.10 ug/m² ~ 35,440 ug/m²

0.23 ug/m² - 44.80 ug/m² IFY:

are tabulated in Appendix D.

tplosive Contamination. PRIN and NG residues were found in the dings 232A, 232C, 232B, and 232G (Pig. 7). The levels of imated to be at or near the detection limit of the TLC

A SURVEY SAMPLING AND ANALYSES.

. Seven buildings, 34 magazines, 28 powder wells and five sewer sampled for heavy metal and explosive residues. The compounds of sted on Table 7. One-half of all samples were stored by the ing the conclusion of the survey in case it was necessary to rete samples (comprising the composite samples), separately. Ho

Samples. At least four surface areas in each of the es were wiped with Whatman No. 541 filter paper, pre-wet with a re were wapen warm mineman no. you assure paper, pro-wor warm a stergent solution. One square mater of surface area was wiped a in selected rooms. Specific sampling sites were based on specific rooms. In general, swipes were taken from a section d, and wall. Swipes were placed in scaled bags and returned for compositing and enalysis by atomic absorption and, ailver, nickel, mercury, chromium, and cadmium.

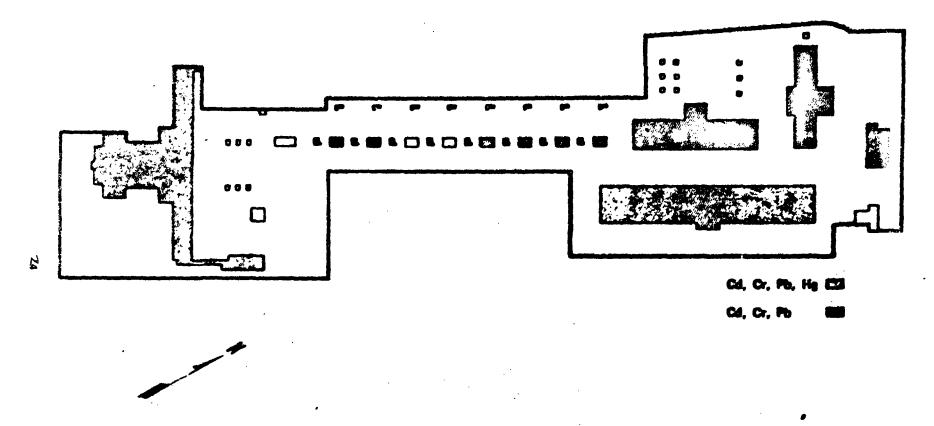


Figure 6. GUSARC Facilities contaminated with heavy metal residues.

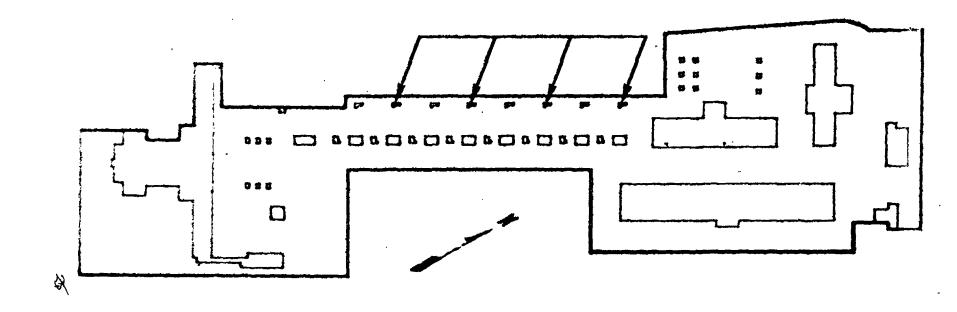


Figure 7. GUSARC Magazines in which floor drains were found to contain explosive residues.

2. Physical Samples. Water samples were collected from five sewer locations. These locations were sewere which drained powder wells, buildings, and magazines in both the GUSARC and Hanley Areas. All samples were placed in pre-washed 500 ml brown glass bottles, labeled, and returned to the laboratory for analysis.

C. Explosives.

1. Spot Sprays.

Five different indicator sprays were used in each room to detect five different explosive classes. Appendix D provides a full listing of spot spray results as well as delineation of which explosives can be detected with each of the five spot spray reagents. The spot spray methodology is described fully in Appendix F.

Spray locations included walls, drains, vents, pipes, window sills, ceiling fixtures, machinery, shelves, stalactites, and floors. Subsequent to the spray application, each location was outlined with a waterproof indelible marker. These areas were numbered (with the spot spray number) and recorded on the data sheets along with the spray results. Over 900 spot sprays were applied. Each room had five locations for spot spray application preselected. Only one spot spray was applied to each location.

Spot spraying was continued in each room of each building (magazines are one-room buildings) until either all five sprays showed negative results at all the locations selected for testing or until a positive response was obtained to one of the spray reagents. Upon obtainment of a positive, a swab sample was collected for the purpose of laboratory analysis to confirm the positive.

The responsiveness of each spray was checked at least once each day by spraying swabs which had been dipped into a 0.012 percent solution of the respective compound. The sprayed swab was observed for the appropriate color change. This procedure constituted an analysis of standard samples.

- 2. Swabs. Swab samples were collected near each location where positive results were obtained with the indicator sprays. Cotton tipped swabs diped in acetone were used to collect these samples. The swabs were placed in wisls for subsequent compositing by magazine group or individual building and laboratory analysis by TLC and HPLC for all explosives listed on Table 7.
- 3. Physical Samples. A one liter water sample was collected from each of 28 powder wells. The sample was collected by submerging pre-washed, brown glass containers below the surface and allowing the water to fill the bottles. Containers were capped, cooled, and returned to the laboratory for analysis. We'ver samples were also collected from five sewer locations.

D. Survey Results.

1. Heavy Metal Contamination.

Swipe samples for heavy metal analyses were composited by building number and mayarine proup and are reported as micrograms per aquare meter fug/m²). Heavy metal concentrations ranged from below detectable limits to 24.

147, 32, and 102 ug/m² for silver, nickel; mercury, and cadmium, respectively. Lead and chromium were found at concentrations above detectable limits in all of the buildings (Fig. 8) surveyed. Concentrations of chromium ranged from 26 to 315 ug/m². Lead concentrations ranged from 800 to 27,260 ug/m². Magazine 219E which housed Hanley's lead axide reactor (and which was the only building in which the glased tiles had been painted) had the highest lead concentration. The average lead concentration for buildings in the Hanley Area was found to be slightly less than 6,000 ug/m². An analytical method for lead axide is not available and therefore lead concentrations must be used to infer the possible presence of lead axide.

Concentrations of eilver, mercury, and chromium were below detectable limits in all sewer samples. Lead concentrations ranged from below detectable limits to 230 ppb. Bickel concentrations ranged from below detectable limits to 115 ppb.

2. Explosive Contamination.

Indicator spot sprays are capable of detecting the presence of explosives nitrite based substances above the level of 0.4 ug/s². Positive spot spray results were obtained in buildings 218A, 218B, 218C, 219A, 219D, 219G, and 220. Positive spot spray results were also obtained in the following magasines:

2198		2278		2287		 228Y
2197	•	227J		2286		 229K
219R		227M		2753		229N
219J	 •	2270		2287	1	 -
227A		228C		228W		

Physical samples (swabs) to check for felse positives were collected from all rooms in all buildings and magazines which exhibited a positive root spray result. These physical samples were composited by building number and by magazine group for additional analysis using thin layer chromatography (Tar) to differentiate between positive responses due to the presence of interferimentarials and positive responses due to the presence of explosives.

High Performance Liquid Chromatography (RPLC) was used to quantify WHX, as TLC was ineffective in identifying this compound. The sensitivity of the TLC method is three orders of magnitude greater than the sensitivity of the TLC method. Therefore, HDK was detected in extremely minute quantities (0.00% - 0.03 ug/cm²) as in the following magasines: 219C, 219H, 227A, 227B, 227O, 228C, and 228F.

TLC and HPLC analyses confirmed the presence of explosives in buildings 218A, 218B, 218C, and 22O. TLC and HPLC analyses also confirmed the presence of explosive contamination in magazines 219C, 219H, 227J, 227H, 227O, 228C at 228P. Megative results were obtained for the 226 and 229 magazine series

The shaded areas shown on Figure 9 indicate the first floor rooms in which explosive residues were detected. The composite sample taken in the stair will leading to the basement of building 218C showed a positive result for PETN and RMX.

2

Figure 8. Hanley Area facilities contaminated with heavy metal residues.

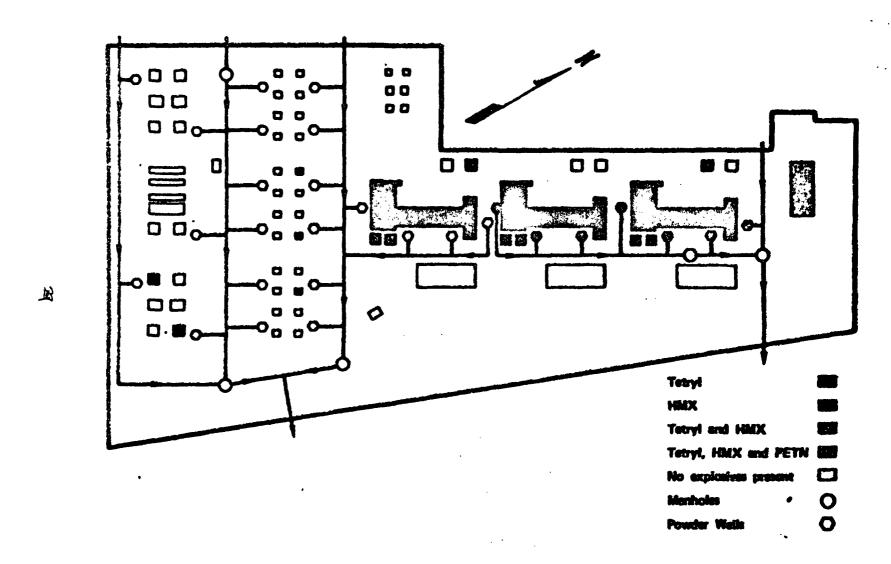


Figure 9. Hantey Area facilities contaminated with explosive residues.

Water samples from the powder wells were composited into nine samples by building or magazine group (maximum of four samples per composite). Explosive compounds were not found in any of the powder well samples above detectable limits except in those samples collected from the powder wells which received effluent from buildings 218A and 218B. The composite samples from these powder wells contained 4.0 and 4.6 ppb of tetryl, respectively.

Wone of the sewer samples contained explosive compounds in concentrations above the detection limit of the method of analysis.

VII. CONCLUSIONS.

A. General. Compositing of samples by individual building in those cases where the buildings contain many rooms or by magazine group was accomplished. Analyses were largely qualitative in nature. Such an approach was necessitated by the lack of historical information on the nature of the installation operations and decontamination by the need to conduct a cost effective survey. Therefore, conclusions, for the most part, are drawn concerning the status of contamination of entire buildings and groups of magazines. Conclusions concerning specific facilities are presented only where quantitative analytical mathods were performed on discrete samples.

B. Goodfellow US Army Reserve Center

- 1. Heavy Metal Residues. As tabulated on Table 10 and shown on Fig. 6, heavy metal residues are present on the walls of 27 buildings and magazines. Due to the lack of information concerning the historical use of buildings, correlation between building usage and survey results is not possible. The concentrations of metals found on the interior building/magazine surfaces are not considered a problem. However, should these residues become airborne, an inhalation hazard could result.
- 2. Explosive Residues. All buildings, magazines and sumps were found to be free of explosive contamination except for magazines 232A, 232C, 232E, and 232G. The floor drains in these four magazines were found to contain explosive residues. A correlation between past usage and survey results is not possible due to the lack of information concerning the historical use of these magazines. The levels of explosives are far below the concentrations required to present an explosive hazard.

C. The Hanley Area.

1. Heavy Netal Residues.

As tabulated in Table 11 and shown on Fig. 8, heavy metal residues were found on all building and magasine interior surfaces and in the discharge of the sewers. As most of the Hanley Area had been used for primer and tracer mixing (operations involving the use of metal based compounds) these results coincide with the historical building usage. The highest level of all heavy metals analyzed for in the survey was found in magasine 2198. This can be explained by the fact that the glazed tile had been painted or by the fact that the Hanley Industries lead aside reactor was operated in this magasine.

TABLE 10

Goodfellow US Army Reserve Center

Survey Findings

Doilding/	Magazine
-----------	----------

Findings

2234 & B

Interview: Tracer Bullet Menufacturing.

Survey: Heavy metal residues present on building

surfaces.

234

Interview: Primer manufacturing.

Survey: Heavy metal residues present on building

surfaces.

surfaces

232A, C, E & G

Records & Interviews: Use unknown.

Survey: Explosive residues present in floor drains;

Survey: No heavy metal or explosive residues present

Survey: Reavy metal residues present on building

heavy metal residues present on building surfaces

2244, B, & C

Recorde & Interviews: Use unknown.

225A, B, C, D, E,

and T;

230; 236F; 237B

231J & L;

233A, B, C, D, E,

and T

244; 222A;

Records and Interviews: Use unknown

232B, D, F, and H;

231A, C, E, G, W, and

243A, B, C, D, E, P,

G, and H

NOTE: Building specific decontemination information is not available. However, there is a record that buildings having emplosive hazards were decontaminated in 1945.

TARLE 41

Hanley Area

Survey Findings¹

Buildings/Negazine	Findings
220	kecords and Interviews: (a) Used for administrative space (1941-1945); (b) Explosive laboratory (1959-1979).
<i>1 7</i>	Survey: Explosive and heavy metal residues present.
218A, B and C	Records and Interviews: (a) Primers and tracer mixing (1941-1945); (b) Loading and mixing of explosives (1959-1979). Survey: Explosive and heavy metal residues present in buildings. Explosive residues present in powder wells draining 218A and B.
219A, D and G	Records and Interviews: (a) Primer and tracer mixing (1941-1945); (b) Loading of smokeless powder (219A) and administrative space (219D and G) from 1959-1979. Survey: Heavy metal residues present.
236	Records and Interviews: (a) Appears to be a garage 1941-1945; (b) 1945-1979 not used. Survey: Heavy metal residues present.
219C and H	Records and Interviews: (a) 1941-1945 use unknown; (b) Open air drying of explosives (1959-1979). Survey: Explosive and heavy metal residues present.
2198	Records and Interviews: (a) 1941-1945 use unknown; (b) Lead azide production (1959-1979). Survey: Heavy metal residues present.
2198, F, and J	Records and Interviews: (a) Open air drying of explosives (2198) and burning (in 219F and J) of explosives (1959-1979). Survey: Heavy metal residues present.
229 Series	Records and Interviews: (a) 1941-1945 use unknown. (b) Storage of explosive end items (1959-1979) Survey: Heavy metal residues present.
226 Series	Records and Interviews: (a) Explosive mixing operations (1941-1945); (b) Storage of explosives in sealed containers (1959-1979). Survey: Heavy metal residues present.

free filt and free and free

1977 B

La Saria

to less the leafund of the state of the stat

Freien process in all med-

2277

to the confidences of the space of the confidence of the confidenc

228 Series2

From 1005-1075.

From 1005-1075.

From 1005 present in all maga
Five recidees present in 2005 and 228F.

Laste: Dailding epocking Contains information is not available.
Minusor, there is a respective to the housing emplosive homer's wore
toomtominated in 1998. The Last is the emplosive homer's wore
toom torbed "MNAN" thich indicates the the entire had been inspected after
decontemination and were considered safe, and that no explosives remained in the

Progazines 228A, B, C, D, G. N, O, and P were reportedly used by the GUSARC for intermittent storage of equipment. Kenley Industries reportedly did not have

2. Explosive Residues.

a. Explosives - General.

Explosive residues were found on the walls in buildings (218A, 218B, 218C and 22O) and magazines (219C, 219H, 227J, 227M, 227O, 228C, 228F), as well as in the standing water present in the powder wells draining buildings 218A and 218B. Ho explosives were detected in the discharge of the sewer system.

- b. 218 Buildings. The presence of explosive residues in 218A, 218B, and 218C coincides with the explosive loading, mixing and disposal operations which were conducted in these buildings from 1941 to 1979. The presence of tetryl in buildings 218A and 218B as well as in the powder wells connected to these buildings leads to the conclusion that the drain lines from these buildings to the powder wells elso contain tetryl. The presence of drop ceilings, wooden roofs, and hollow tiles raise the concern that residues may have accumulated on top of the ceilings and within the walls.
- c. Building 220. The presence of explosive residues in this building is understandable as this was Hanley's explosive laboratory. It is assumed that the drains in this building were used for disposing of small quantities of explosives. Building 220 has a cement ceiling which would keep any explosive residues from entering the top of the wall and sifting down through and accumulating in the hollow tiles.

d. Magazines 227E, P, G, R, J, K, L, and M.

The results of the analyses on physical samples collected from magazines 227J and 227M show explosive contamination (RNX and Tetryl) to be present at significant levels. As these two magazines are indicative of the contamination present in the group of magazines, the group is considered to contain the same level of contamination. The level found was commensurate with the levels of contamination found in buildings 218A, 218B, 218C and 220.

All of the magazines have drop ceilings and are constructed of wood. It is accluded that these magazines have a high potential to contain explosive residues in the the walls and above the ceilings.

e. Magazines 219C, 219H, 227O, 228C, and 228F.

These magazines were found to contain trace amounts of HMX in residues sampled from the magazine interiors. The levels were at least two orders of magnitude lower than the levels found in other buildings and magazines (227E, F, G, E, I, K, L, and M). It is concluded that these levels are not sufficient to pose an explosion hazard but that low levels of explosives could be present. It is further concluded that these levels are indicative of the trace levels of contains and which may be present in all of the magazines in the Hanley Area.

f. Powder Wells.

Tetryl was found only in the water in the seven powder wells draining buildings 218A and 218B. The sludge in the powder wells could not be analyzed for explosives as a suitable analytical method is not available. Due to the presence of sludge in each of the 28 powder wells it is concluded that explosive residues may be present in the sludge in each powder well.

VIII. Recommendations

A. Goodfellow US Army Reserve Center Area

- 1. Heavy Metal Contamination. Since there were no standards for the heavy metal contamination found at the GUSARC, it was recommended that the DOL:
- a. Conduct air monitoring for heavy metals to assure compliance with OSHA standards; and
- b. Sample the liquid discharge from the sewer system to assure compliance with the discharge standards of the city of St. Louis.
- 2. Magazines 232A, 232C, 232E and 232G. In regard to the explosive residues found in the floor drains of magazines 232A, 232C, 232E, and 232G the following recommendations were provided:
- a. The floor drains should be scraped of all residue prior to connecting the gutters to the floor drains.
- b. Floor drains which will not be used should be cleaned (to ensure that no large accumulations of explosives are present) and then filled with concrete.
- c. Pipes should not be welded onto existing pipes, rather, molten lead packing should be used.
- d. Flame producing machinery associated with the removation operations should be operated outside of the magazines.

B. Hanley Area.

- 1. Heavy Metal Contemination. As the buildings and magazines in the Manley Area will be demolished, the levels of heavy metals found on the building/magazine surfaces should pose no problem. Air monitoring or the use of respirators during rip-out operations is recommended. The liquid discharge from the sewer system should be sampled to assure compliance with the discharge standards of the city of St. Louis.
- 2. Buildings 218A, 218B, 218C, and 22O. These buildings should be flashed [consideration could be given to the possibility of chemically neutralizing building 22O, however, flashing is the recommended decontamination procedure). In order to avoid hazards associated with airborne asbestos, all

asbestos materials must be removed prior to burning. The drain lines leading to the powder wells draining buildings 218A and 218B should be removed and flashed. The drain lines from building 220 to the sewer main should also be removed and flashed.

3. Magazines 227E, F, G, H, J, K, L, and M. The magazines in this group should be flashed prior to demolition. All asbestos materials must be removed prior to hurning to avoid generating an asbestos inhalation hazard.

4. Remainder of Hanley Area.

- a. Renovation and demolition operations involving all other magazines and buildings in the Hanley Area should be conducted without the use of spark or flame producing machinery. All work in the Hanley Area should be carried out under the guidance of a safety officer and with the understanding that undetected levels of explosives may exist.
 - b. All drain lines should be cleaned and filled with concrete.
- c. Access to the Hanley Area should be controlled until all decontamination/demolition work is completed.
- C. General. The following recommendations are applicable to both the Goodfellow US Army Reserve Center Area and the Hanley Area.
- 1. All work in these areas should be overseen by perso knowledgeable of the contamination.
- 2. Personnel involved in decontamination activities should not work alone.
- 3. A complete record of all decontamination actions should be maintained in order to verify the adequacy of the decontamination. This record should include numbers and names of demolition techniques employed.
 - 4. Flame producing devices should not be used before decontamination.
- 5. Standard operating procedures (SOP's) should be prepared for all operations conducted in the contaminated portions of SLOP. An example of such an SOP is found at Appendix G.
- All powder wells and sumps containing sludge should be drained of their contents and the sumps and wells should be flashed.
- 7. Flashing entails subjecting the potentially contaminated surface to a hot fire in order to destroy the explosive material. In the case of the buildings, magazines, drain lines, sumps, powder wells, and sludges from the powder wells at SLOP for which flashing is recommended, "flashing" can only be achieved by total burning. (It is noted that solvents and steam cleaning are considered effective decontamination procedures only when complete inspection can be given to all surfaces to assume decontamination has occurred).
- 8. Should open burning of buildings and magazines pose a problem because of the location of SLOP, a technique which has been used successfully is a charcoal fire. This technique produces a high temperature, controlled burn with far less smoke and flame.

A CONTRACTOR

Tality Assurance Program for US Army Toxic and Reservous Naturials Agency,

Army Research Office letter, dated 16 Mer 79, assigning Task Control No. USATHAMA's Request for Scientific Services (Delivery Order No.

Hay Research Office letter, dated 23 Jul 80, assigning Task Control No. 16 to USATRAMA's Request for Scientific Services (Delivery Order No.

ind, 17 Jen 79, to letter, DARN-REN-C, EQDA, 18 Dec 78, subject: listion Restoration, Goodfellow US Army Reserve Center (Portion of

Regulation 10-30, 22 May 79: Mission and Major Functions of the US

from US Army Ballistic Research Laborately to DERTH-IR, USATRAMA, 26 subject: Rediological Survey - St. Louis Ordnance Plant.

rom ALUGD-EN to Commanding General, Fifth US Army, Chicago, IL, Peb 61, subject: Chemical Area Bo. 2, St. Louis Ordnance Plant.

com ALUBEN to Commanding Officer, St. Louis Ordnance Plant, dated 27

ed, Pacilities, Equipment, Customers and Products," Hanley

l Facility Survey of Hanley Industries Incorporated conducted on

ations between Mr. Gaynor Blake, President of Hanley William Colvin, USATRAMA, on 21 May 80 and 20 Jun 80, se of Buildings and Magazines in the Hanley Area of SLOP.

lumbus Laboratories Report: "Sampling and Analysis for Id Heavy Metal Residue at St. Louis Ordnance Plant - Hanley

mbus Leboratories Report: "Sampling and Analysis of Selected oodfellow US Army Reserve Center (Portion of Pormer St. Louis

r Chemical Systems Laboratory Records Search and Onsite Visit low US Army Reserve Center conducted 10-12 Jan 79.

TH-PS to DRCIS-EP, 17 May 79, Subject: Installation ndfellow US Army Reserve Center (Portion of Pormer St. Louis

REFERENCES (Cont'd)

- Letter from DRXTH-FS, USATHAMA to DRCIS-EP, DARCON, 15 Jun 79, subject: Survey of 13.2 Acre Area of Goodfellow US Army Reserve Center (Portion of Former St. Louis Ordnance Plant), Missouri.
- Memorandum for Chief, Field Systems Division of USATHAMA, 21 Jun 79, subject: Meeting with Department of Labor Concerning Results of Goodfellow Reserve Center Contamination Survey.
- Department of the Army Permit to Other Federal Government Department or Agency to Use Property on US Army Reserve Center No. 4, St. Louis, Hissouri. Permit No. DACA41-4-79-546.
- Memorandum for Record from DRCIS-A, DARCOM, May 80, subject: Meeting Between the US Army and Department of Labor Concerning USARC (Goodfellow), St. Louis, 22 May 80.
- Letter from DRXTH-FS, USATHAMA to DRCIS-A, DARCOM, dated 30 Jun 80, subject: USARC Goodfellow, St. Louis, NO; Hanley, Inc. Former Lessee (14.68 acres); Portion of Former St. Louis Ordnance Plant.
- Letter from DRXTH-FS, USATHAMA to DRCIS, DARCOM, 10 Oct 80, subject: USARC Goodfellow, St. Louis, MO; Hanley, Inc. Former Lessee (14.68 acres); Portion of Former St. Louis Ordnance Plant.
- Letter from DRXTH-FS, USATHAMA to DRCIS-A, DARCON TO Nov 80, subject: Hanley, Inc. (Former Lessee) Area of Former Goodfellow US Army Reserve Center (Portion of Former St. Louis Ordnance Plant), St. Louis, Missouri.
- Indorsement, 9 Jun 81, to letter, DRXTH-FS, USATHAMA, 19 May 81, subject: Request for Review of Draft Report of Survey of Hazardous/Chemical Area Mo. 2 of the Former St. Louis Ordnance Plant.

DISTRIBUTION:

DRATH-ES	2 copies
Defense Logistics Studies Information Exchange US Army Logistics Management Center Fort Lee, VA 23801	2 copies
Defense Technical Information Center Cameron Station	12 copies
Alexandria, VA 22314	
US Army Materiel Development and Readiness Command ATTN: DRCIS-ER 5001 Eisenhower Avenue Alexandria, VA 22333	1 сору
HQDA (DAEH-REH-C) Washington, DC 20314	1 copy
District Engineer Real Estate Div, COR Ransas City, NO 64101	1 сору
Pt. Leonard Wood Pacility Engineering Activity 210 H. 12th Street (Room 411) St. Louis, ND 63101	1 сору